

# 1998–2005 Ford Ranger Blower Motor Speed Selection Troubleshoot

Experiencing an issue with the blower motor speed selection on a 1998–2005 Ford Ranger?


The most likely problem is the blower motor resistor has failed and will require replacement. Another common problem is the electrical connector/blower motor resistor pigtail connected to the blower motor resistor may have a short causing the socket connection to melt.

gpd blower motor resistor pigtail 1712270 can be used to replace the burnt socket. The old blower motor resistor pigtail will need to be cut out and replaced with 1712270.

For proper installation, reference the guidelines below.



1712270  
Blower Motor Resistor Pigtail

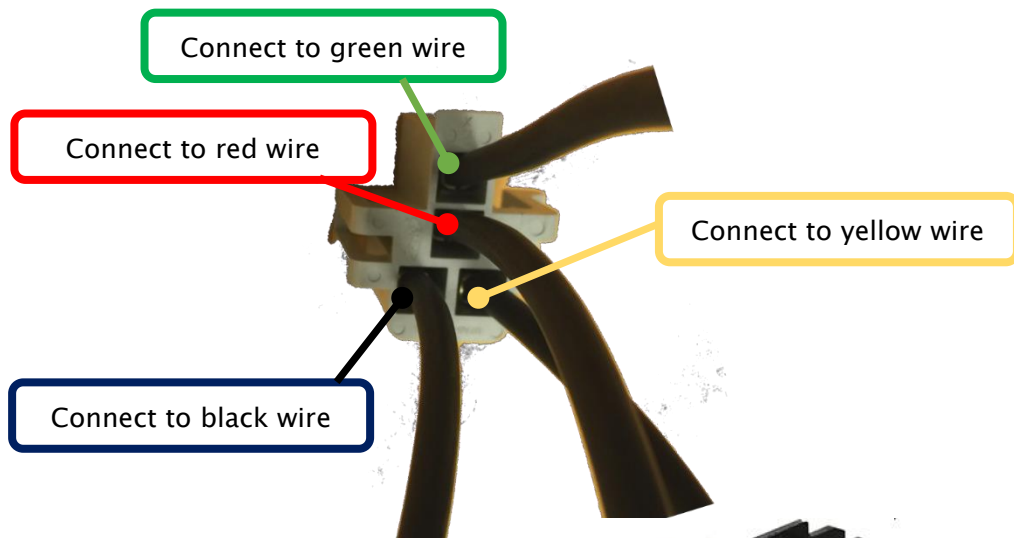

gpd blower motor resistor 1711725 is a direct fit replacement for the front blower motor resistor in both manual and automatic A/C systems. It has a two-hole mount.



1711725  
Blower Motor Resistor

Manufacturer names, logos and part numbers are for reference only. All prices, taxes and availability are subject to change without notice. This document and any files transmitted with it are confidential and intended solely for the use of the individual or entity to which they are addressed. If you have received this document in error, please delete it immediately. Note that any views or opinions presented in this document are solely those of the author. Any unauthorized review, use, disclosure, or distribution is prohibited. Global Parts Distributors, LLC (gpd) accepts no liability for any damage caused by any virus or other means transmitted by this document. © Global Parts Distributors, LLC (gpd)